


V:\PROJECTS\2021\21-0003 - POMPEY PARK SURVEY\DRAWINGS\21-0003_10.DWG 2021/10/18 11:24 by SELVR

MATCH LINE A-A, SEE SHEET 1 OF 5

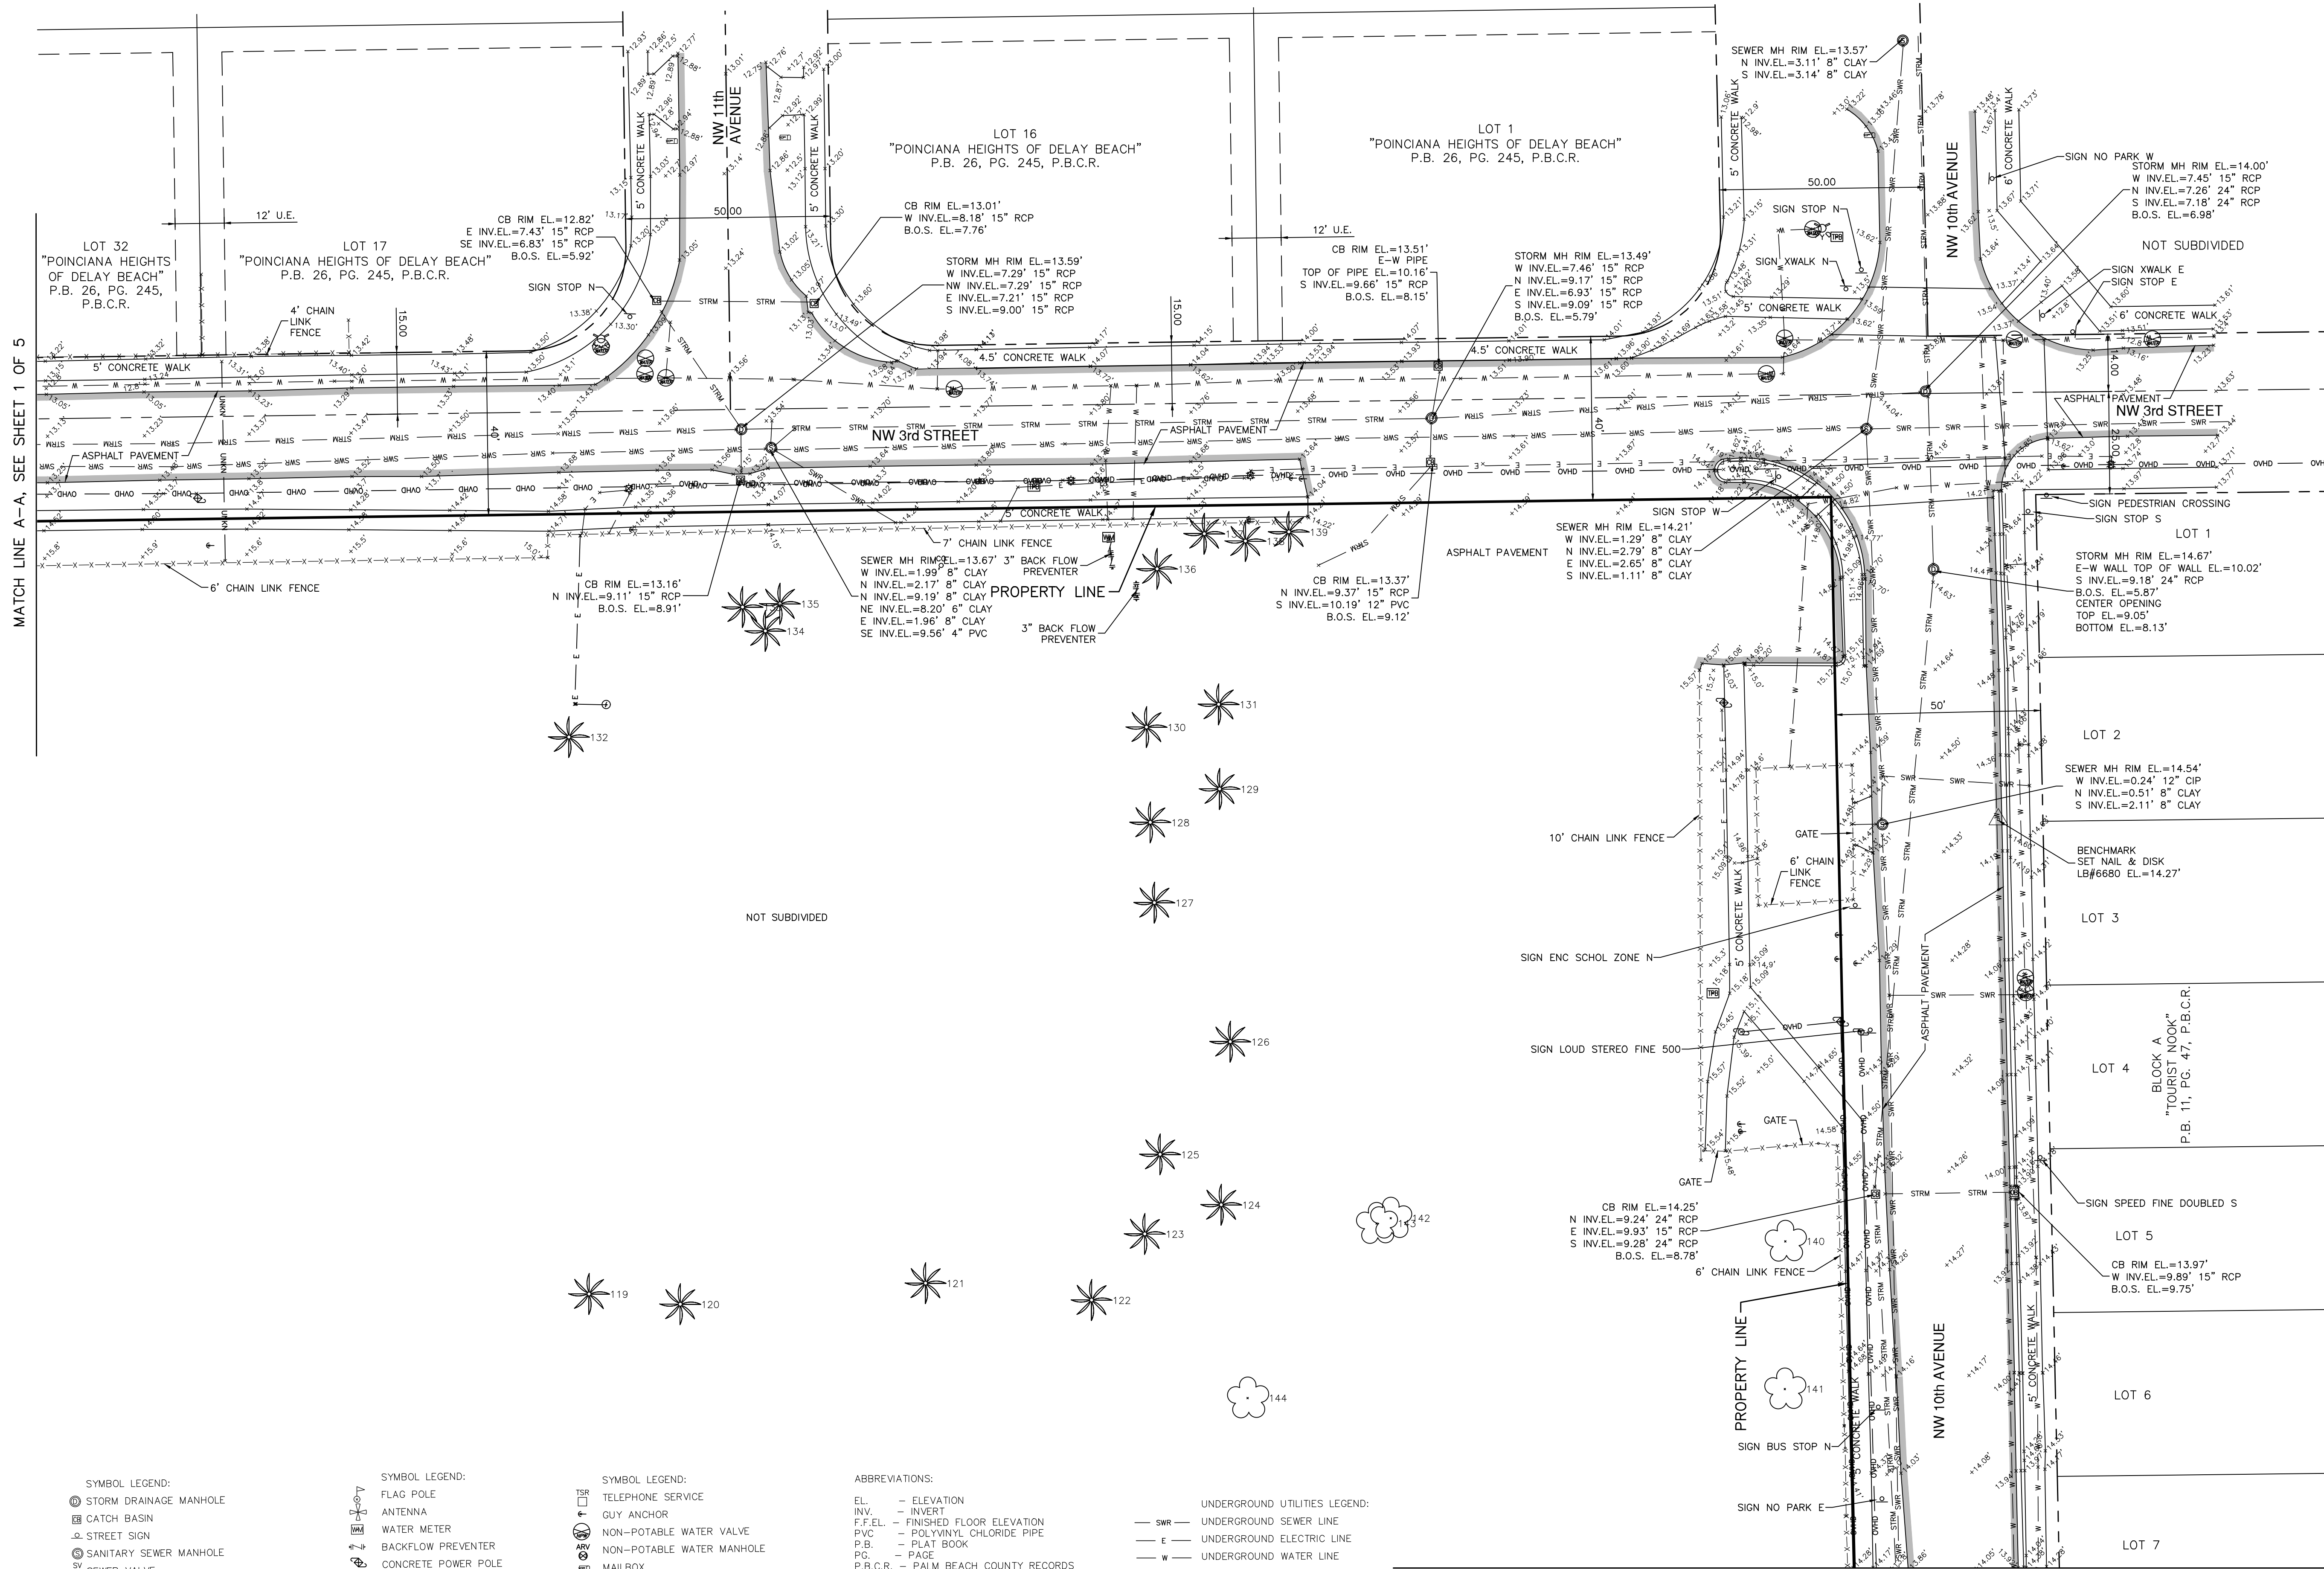

MATCH LINE B-B, SEE SHEET 3 OF 5


- SYMBOL LEGEND:
- STORM DRAINAGE MANHOLE
 - CATCH BASIN
 - STREET SIGN
 - SANITARY SEWER MANHOLE
 - SEWER VALVE
 - CLEAN OUT
 - WIRE PULL BOX
 - WATER VALVE
 - WOOD POWER POLE
 - CONCRETE LIGHT POLE
 - IRRIGATION CONTROL BOX
 - ELECTRIC METER
 - ELECTRIC SERVICE BOX
 - FIRE HYDRANT

- SYMBOL LEGEND:
- FLAG POLE
 - ANTENNA
 - WATER METER
 - BACKFLOW PREVENTER
 - CONCRETE POWER POLE
 - CABLE TV SERVICE BOX
 - TRASH CAN
 - ELECTRIC MANHOLE
 - BENCH
 - AIR CONDITIONING UNIT
 - GAS METER
 - VALVE
 - TRANSFORMER
 - WOOD LIGHT POLE

- SYMBOL LEGEND:
- TELEPHONE SERVICE
 - GUY ANCHOR
 - NON-POTABLE WATER VALVE
 - NON-POTABLE WATER MANHOLE
 - MAILBOX
 - BOLLARD
 - MANHOLE
 - COLUMN
 - CLEANOUT
 - IRRIGATION CONTROL VALVE

- ABBREVIATIONS:
- EL. - ELEVATION
 - INV. - INVERT
 - F.F.E.L. - FINISHED FLOOR ELEVATION
 - P.V.C. - POLYVINYL CHLORIDE PIPE
 - P.B. - PLAT BOOK
 - P.C. - PAGE
 - P.B.C.R. - PALM BEACH COUNTY RECORDS
 - U.E. - UTILITY EASEMENT
 - B.O.S. - BOTTOM OF STRUCTURE
 - C.M.P. - CORRUGATED METAL PIPE
 - R.C.P. - REINFORCED CONCRETE PIPE
 - H.D.P.E. - HIGH DENSITY POLYETHYLENE PIPE
 - DIA. - DIAMETER
 - CLF - CHAIN LINK FENCE
 - B.F.P. - BACKFLOW PREVENTER
 - R/W - RIGHT OF WAY
 - CL - CENTERLINE

- UNDERGROUND UTILITIES LEGEND:
- SWR - UNDERGROUND SEWER LINE
 - E - UNDERGROUND ELECTRIC LINE
 - W - UNDERGROUND WATER LINE
 - STRM - STORM DRAINAGE LINE
 - COMM - COMMUNICATION LINE
 - G - GAS LINE
 - UNKN - UNKNOWN LINE
- TREE LEGEND:
- 10 - TREE CHART NUMBER
 - * - PALM TREE
 - - TREE

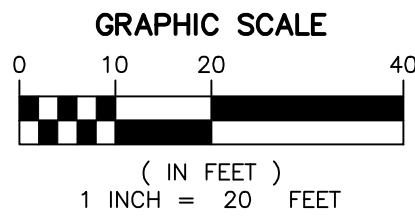

SKETCH OF TOPOGRAPHIC SURVEY

POMPEY PARK COMMUNITY CENTER
CITY OF DELRAY BEACH, PALM BEACH COUNTY, FL

MILLER LEGG
South Florida Office: 5747 N. Andrews Way
Ft. Lauderdale, Florida 33309-2364
954-535-7000 Fax: 954-435-8664
www.millerlegg.com


CERTIFICATE OF AUTHORIZATION:
EB7318 LB6680 LC0337
PROJECT / FILE NO.
21-00053
DRAWING NO.
TS-2
DATE DRAWN:
7/22/21

REV	DATE	BY	CHK	REVISIONS
1	10/15/21	SELVR	MR	REVISED TO SHOW ADDITIONAL INFO.



CERTIFICATES OF AUTHORIZATION:		
EB7318 LB6680 LC0337		
	LP	MR
DES.	DWN.	CHK.
PROJECT / FILE NO.		
21-00053		
DRAWING NO.		
TS-3		
DATE DRAWN:		
7/22/21		

POMPEY PARK COMMUNITY CENTER
CITY OF DELRAY BEACH, PALM BEACH COUNTY, FL

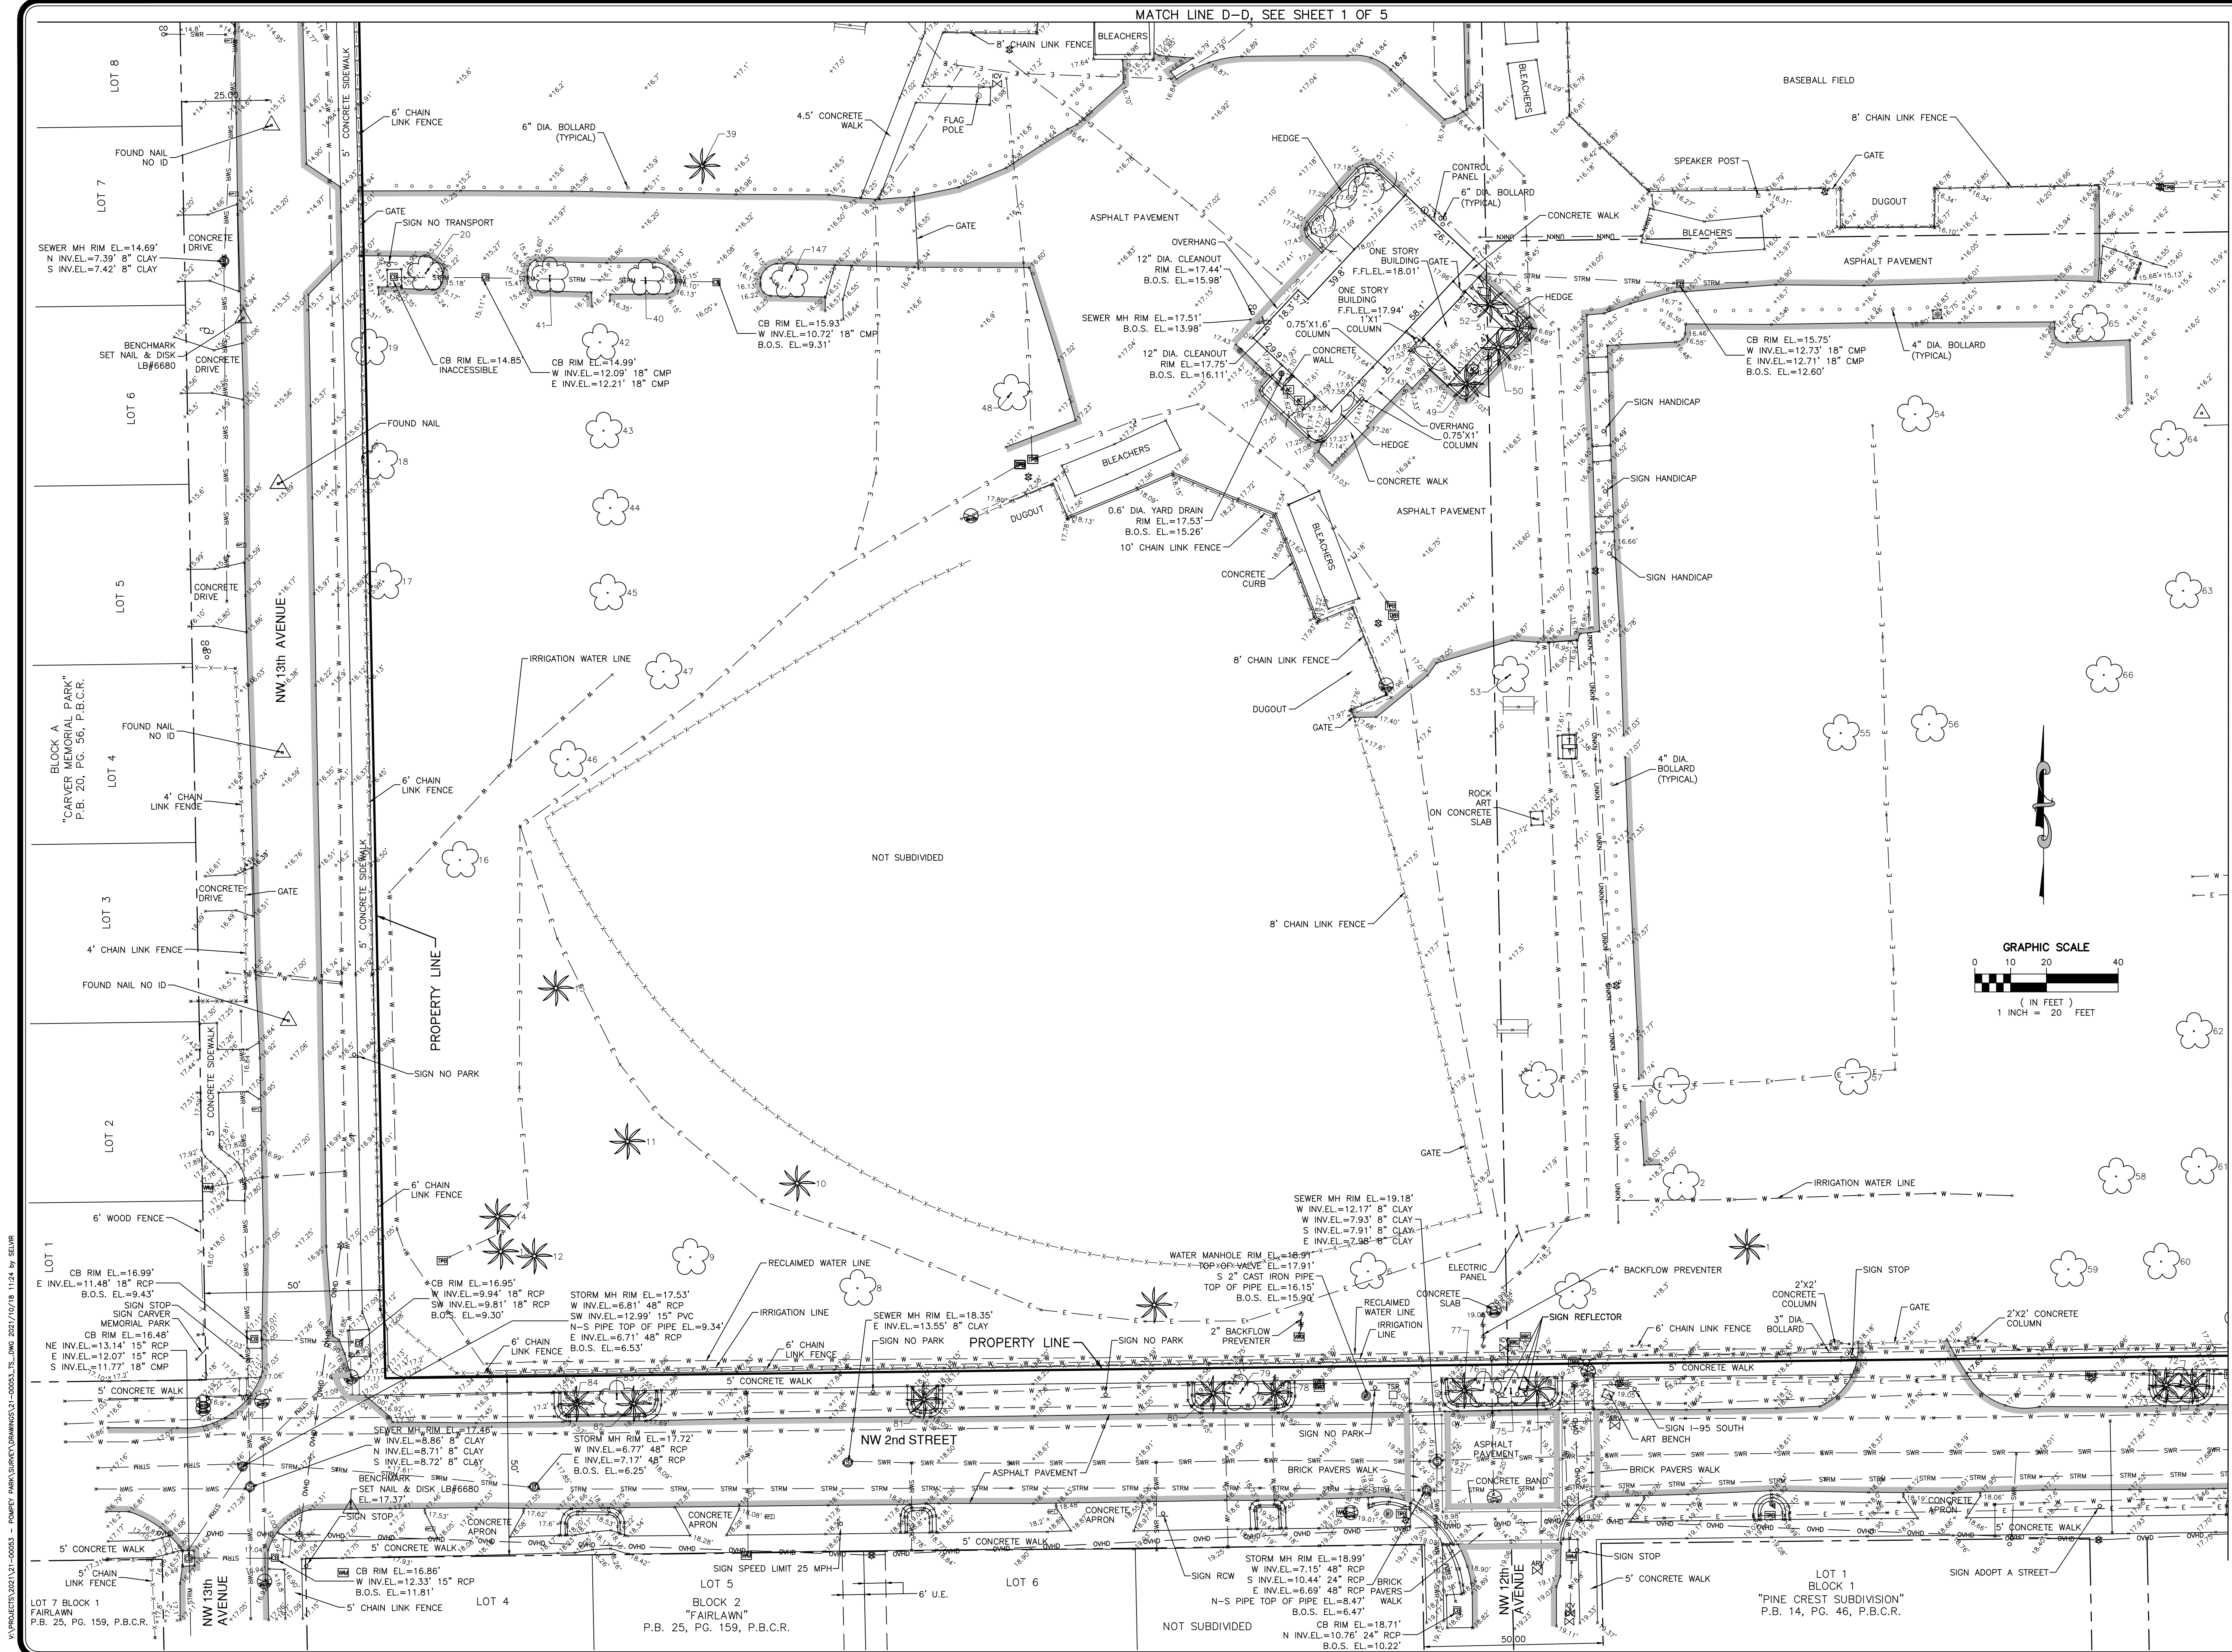

MATCH LINE C-C, SEE SHEET 3 OF 5

SKETCH OF TOPOGRAPHIC SURVEY

POMPEY PARK COMMUNITY CENTER

CITY OF DELRAY BEACH, PALM BEACH COUNTY, FL



CERTIFICATE OF AUTHORIZATION			
EB7318 LB6680 LC0337			
DES.	LP.	MR.	
PROJECT / FILE NO.	21-00053		
DRAWING NO.	TS-4		
DATE DRAWN:	7/22/21		

REVISED TO SHOW ADDITIONAL INFO.	MR.	SE
DATE	REV	DATE
10/10/21	REV	10/10/21

V:\PROJECTS 2021\21-00053 - POMPEY PARK SURVEY DRAWINGS\21-00053_TS_LDWG 2021/10/18 11:28 by SELVR

Tree ID	Common Name	Species	DBH	Multi Trunk	Height	Spread	Trunks	General Condition	Condition 1	Condition 2	Condition 3
1	Cabbage Palm	<i>Sabal palmetto</i>	13	No	20	14	1	Fair (41% to 60%)	Tapered Trunk		
2	Mahogany	<i>Swietenia mahagoni</i>	15	No	30	38	1	Fair (41% to 60%)	Slight Lean	Limb Damage - Minor	Lopsided
3	Mahogany	<i>Swietenia mahagoni</i>	15	No	26	30	1	Poor (21% to 40%)	Leaning - Major	Bent Leader	Limb Damage - Minor
4	Weeping Fig	<i>Ficus benjamina</i>	65	No	42	60	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	Trunk Damage - Minor
5	Sea Grape	<i>Coccoloba uvifera</i>	60	Yes	36	36	4	Poor (21% to 40%)	Co-Dominant Leaders	Limb Damage - Major	Trunk Damage - Major
6	Strangler Fig	<i>Ficus aurea</i>	60	Yes	38	42	2	Poor (21% to 40%)	Co-Dominant Leaders	Limb Damage - Major	Trunk Damage - Major
7	Cabbage Palm	<i>Sabal palmetto</i>	10	No	22	14	1	Fair (41% to 60%)	Tapered Trunk		
8	Weeping Fig	<i>Ficus benjamina</i>	67	Yes	44	60	2	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	Bent Leader
9	Banyan Tree	<i>Ficus benghalensis</i>	100	Yes	36	50	10	Very Poor (6% to 20%)	Mostly Defoliated	Limb Damage - Major	Trunk Damage - Major
10	Cabbage Palm	<i>Sabal palmetto</i>	13	No	26	14	1	Good (61% to 80%)			
11	Cabbage Palm	<i>Sabal palmetto</i>	12	No	30	14	1	Good (61% to 80%)			
12	Cabbage Palm	<i>Sabal palmetto</i>	10	No	26	14	1	Fair (41% to 60%)	Bent Trunk	Trunk Damage	
13	Cabbage Palm	<i>Sabal palmetto</i>	12	No	20	14	1	Fair (41% to 60%)	Bent Trunk		
14	Cabbage Palm	<i>Sabal palmetto</i>	13	No	22	14	1	Fair (41% to 60%)	Bent Trunk		
15	Cabbage Palm	<i>Sabal palmetto</i>	12	No	20	14	1	Good (61% to 80%)			
16	Weeping Fig	<i>Ficus benjamina</i>	50	Yes	38	50	2	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	Trunk Damage - Minor
17	Mahogany	<i>Swietenia mahagoni</i>	16	No	30	30	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	Bent Leader
18	Mahogany	<i>Swietenia mahagoni</i>	16	No	34	32	1	Poor (21% to 40%)	Co-Dominant Leaders	Limb Damage - Minor	Bent Leader
19	Mahogany	<i>Swietenia mahagoni</i>	14	No	32	32	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	Bent Leader
20	Mahogany	<i>Swietenia mahagoni</i>	19	No	36	32	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	Lopsided
21	Strangler Fig	<i>Ficus aurea</i>	54	No	40	44	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	Sprouting
22	Cabbage Palm	<i>Sabal palmetto</i>	12	No	26	14	1	Very Poor (6% to 20%)	Encompassed by strangler fig		
23	Live Oak	<i>Quercus virginiana</i>	1	No	6	4	1	Good (61% to 80%)			
24	Live Oak	<i>Quercus virginiana</i>	1	No	6	4	1	Good (61% to 80%)			
25	Live Oak	<i>Quercus virginiana</i>	1	No	10	4	1	Good (61% to 80%)			
26	Live Oak	<i>Quercus virginiana</i>	1	No	10	4	1	Good (61% to 80%)			
27	Live Oak	<i>Quercus virginiana</i>	1	No	8	4	1	Good (61% to 80%)			
28	Live Oak	<i>Quercus virginiana</i>	1	No	8	4	1	Good (61% to 80%)			
29	Red Stopper	<i>Eugenia rhombea</i>	2	No	5	4	1	Good (61% to 80%)			
30	Red Stopper	<i>Eugenia rhombea</i>	2	No	5	4	1	Good (61% to 80%)			
31	Red Stopper	<i>Eugenia rhombea</i>	2	No	5	4	1	Good (61% to 80%)			
32	Red Stopper	<i>Eugenia rhombea</i>	2	No	5	4	1	Good (61% to 80%)			
33	Red Stopper	<i>Eugenia rhombea</i>	2	No	5	4	1	Good (61% to 80%)			
34	Red Stopper	<i>Eugenia rhombea</i>	2	No	5	4	1	Good (61% to 80%)			
35	Red Stopper	<i>Eugenia rhombea</i>	2	No	5	4	1	Good (61% to 80%)			
36	Red Stopper	<i>Eugenia rhombea</i>	2	No	5	4	1	Good (61% to 80%)			
37	Cabbage Palm	<i>Sabal palmetto</i>	15	No	12	14	1	Good (61% to 80%)			
38	Cabbage Palm	<i>Sabal palmetto</i>	12	No	36	12	1	Fair (41% to 60%)	Bent Trunk		
39	Spindle Palm	<i>Hyophorbe verschaffeltii</i>	10	No	12	8	1	Good (61% to 80%)			
40	Mahogany	<i>Swietenia mahagoni</i>	20	No	40	36	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	
41	Mahogany	<i>Swietenia mahagoni</i>	18	No	34	34	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	Lopsided
42	Mahogany	<i>Swietenia mahagoni</i>	16	No	32	30	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	Lopsided
43	Mahogany	<i>Swietenia mahagoni</i>	16	No	32	36	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	Lopsided
44	Mahogany	<i>Swietenia mahagoni</i>	15	No	30	32	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	
45	Mahogany	<i>Swietenia mahagoni</i>	21	No	38	40	1	Good (61% to 80%)	Co-Dominant Leaders	Constricted Roots	
46	Mahogany	<i>Swietenia mahagoni</i>	16	No	30	32	1	Fair (41% to 60%)	Slight Lean	Limb Damage - Minor	
47	Mahogany	<i>Swietenia mahagoni</i>	15	No	32	30	1	Fair (41% to 60%)	Bent Leader	Limb Damage - Minor	Sprouting
48	Weeping Fig	<i>Ficus benjamina</i>	63	No	40	56	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	Trunk Damage - Minor
49	Montgomery Palm	<i>Veitchia montgomeryana</i>	6	No	8	10	1	Good (61% to 80%)			
50	Montgomery Palm	<i>Veitchia montgomeryana</i>	10	Yes	10	12	2	Good (61% to 80%)			
51	Montgomery Palm	<i>Veitchia montgomeryana</i>	6	No	10	10	1	Good (61% to 80%)			
52	Montgomery Palm	<i>Veitchia montgomeryana</i>	10	Yes	12	12	2	Good (61% to 80%)			
53	Weeping Fig	<i>Ficus benjamina</i>	49	No	42	48	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	Trunk Damage - Minor
54	Mahogany	<i>Swietenia mahagoni</i>	16	No	34	30	1	Fair (41% to 60%)	Bent Leader	Circling Roots	Limb Damage - Minor
55	Mahogany	<i>Swietenia mahagoni</i>	18	No	32	34	1	Fair (41% to 60%)	Bent Leader	Limb Damage - Minor	Constricted Roots
56	Mahogany	<i>Swietenia mahagoni</i>	17	No	32	34	1	Fair (41% to 60%)	Bent Leader	Limb Damage - Minor	Constricted Roots
57	Mahogany	<i>Swietenia mahagoni</i>	14	No	24	20	1	Fair (41% to 60%)	Bent Leader	Limb Damage - Minor	
58	Mahogany	<i>Swietenia mahagoni</i>	13	No	22	20	1	Poor (21% to 40%)	Bent Leader	Limb Damage - Minor	Hat Racked
59	Sea Grape	<i>Coccoloba uvifera</i>	36	Yes	36	32	2	Poor (21% to 40%)	Co-Dominant Leaders	Limb Damage - Major	Lopsided
60	Sea Grape	<i>Coccoloba uvifera</i>	40	Yes	38	36	2	Poor (21% to 40%)	Co-Dominant Leaders	Limb Damage - Major	Lopsided
61	Black Olive	<i>Bucida buceras</i>	28	No	38	32	1	Poor (21% to 40%)	Apical Dieback	Co-Dominant Leaders	Limb Damage - Major
62	Black Olive	<i>Bucida buceras</i>	25	No	36	38	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	
63	Black Olive	<i>Bucida buceras</i>	26	No	38	38	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	
64	Black Olive	<i>Bucida buceras</i>	24	No	38	40	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	
65	Mahogany	<i>Swietenia mahagoni</i>	12	No	24	20	1	Fair (41% to 60%)	Bent Leader	Slight Lean	Limb Damage - Minor
66	Mahogany	<i>Swietenia mahagoni</i>	14	No	32	30	1	Poor (21% to 40%)	Limb Damage - Major	Co-Dominant Leaders	Lopsided
67	Cabbage Palm	<i>Sabal palmetto</i>	8	No	20	12	1	Fair (41% to 60%)	Bent Trunk	Tapered Trunk	
68	Live Oak	<i>Quercus virginiana</i>	49	No	40	50	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	Trunk Damage - Minor
69	Live Oak	<i>Quercus virginiana</i>	47	No	42	50	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	Trunk Damage - Minor
70	Live Oak	<i>Quercus virginiana</i>	43	No	42	48	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	Trunk Damage - Minor
71	Spindle Palm	<i>Hyophorbe verschaffeltii</i>	12	No	12	12	1	Good (61% to 80%)			
72	Jatropha	<i>Jatropha Spp.</i>	5	No	12	14	1	Fair (41% to 60%)	Bent Leader	Hat Racked	Lopsided
73	Spindle Palm	<i>Hyophorbe verschaffeltii</i>	12	No	12	12	1	Good (61% to 80%)			
74	Spindle Palm	<i>Hyophorbe verschaffeltii</i>	12	No	12	12	1	Good (61% to 80%)	Tapered Trunk		
75	Jatropha	<i>Jatropha Spp.</i>	5	No	12	14	1	Poor (21% to 40%)	Leaning - Major	Limb Damage - Major	
76	Jatropha	<i>Jatropha Spp.</i>	6	No	12	14	1	Good (61% to 80%)	Leaning - Minor		
77	Spindle Palm	<i>Hyophorbe verschaffeltii</i>	12	No	12	12	1	Good (61% to 80%)	Tapered Trunk		
78	Spindle Palm	<i>Hyophorbe verschaffeltii</i>	12	No	12	12	1	Good (61% to 80%)	Tapered Trunk		
79	Jatropha	<i>Jatropha Spp.</i>	6	No	12	14	1	Good (61% to 80%)	Leaning - Minor		
80	Spindle Palm	<i>Hyophorbe verschaffeltii</i>	10	No	10	12	1	Good (61% to 80%)	Tapered Trunk		
81	Spindle Palm	<i>Hyophorbe verschaffeltii</i>	10	No	10	12	1	Good (61% to 80%)	Trunk Damage		
82	Spindle Palm	<i>Hyophorbe verschaffeltii</i>	10	No	10	12	1	Good (61% to 80%)	Trunk Damage		
83	Jatropha	<i>Jatropha Spp.</i>	6	No	12	14	1	Good (61% to 80%)	Leaning - Minor		
84	Spindle Palm	<i>Hyophorbe verschaffeltii</i>	10	No	10	12	1	Good (61% to 80%)	Trunk Damage		
85	Live Oak	<i>Quercus virginiana</i>	43	No	40	42	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	Trunk Damage - Minor
86	Live Oak	<i>Quercus virginiana</i>	34	No	40	46	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	Trunk Damage - Minor
87	Live Oak	<i>Quercus virginiana</i>	34	No	42	48	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	Trunk Damage - Minor
88	Spindle Palm	<i>Hyophorbe verschaffeltii</i>	12	No	10	12	1	Good (61% to 80%)			
89	Live Oak	<i>Quercus virginiana</i>	31	No	42	42	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	Trunk Damage - Minor
90	Live Oak	<i>Quercus virginiana</i>	37	No	44	38	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	Trunk Damage - Minor
91	Live Oak	<i>Quercus virginiana</i>	27	No	42	36	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	Lopsided
92	Live Oak	<i>Quercus virginiana</i>	32	No	42	38	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	Adj Power Lines
93	Live Oak	<i>Quercus virginiana</i>	25	No	34	38	1	Fair (41% to 60%)	Adj Power Lines	Co-Dominant Leaders	Limb Damage - Minor

Tree ID	Common Name	Species	DBH	Multi Trunk	Height	Spread	Trunks	General Condition	Condition 1	Condition 2	Condition 3
94	Live Oak	<i>Quercus virginiana</i>	30	No	36	40	1	Fair (41% to 60%)	Adj Power Lines	Co-Dominant Leaders	Limb Damage - Minor
95	Live Oak	<i>Quercus virginiana</i>	26	No	38	40	1	Fair (41% to 60%)	Adj Power Lines	Co-Dominant Leaders	Limb Damage - Minor
96	Live Oak	<i>Quercus virginiana</i>	38	No	44	42	1	Fair (41% to 60%)	Adj Power Lines	Co-Dominant Leaders	Limb Damage - Minor
97	Black Olive	<i>Bucida buceras</i>	23	No	38	40	1	Fair (41% to 60%)	Co-Dominant Leaders	Trunk Damage - Minor	Limb Damage - Minor
98	Black Olive	<i>Bucida buceras</i>	16	No	39	36	1	Fair (41% to 60%)	Co-Dominant Leaders	Sprouting	Limb Damage - Minor
99	Black Olive	<i>Bucida buceras</i>	29	No	40	36	1	Poor (21% to 40%)	Trunk Damage - Major	Lopsided	Limb Damage - Minor
100	Black Olive	<i>Bucida buceras</i>	14	No	32	30	1	Fair (41% to 60%)	Bent Leader	Limb Damage - Minor	
101	Black Olive	<i>Bucida buceras</i>	20	No	38	36	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	Bent Leader
102	Black Olive	<i>Bucida buceras</i>	20	No	40	36	1	Poor (21% to 40%)	Co-Dominant Leaders	Limb Damage - Major	Bent Leader
103	Cabbage Palm	<i>Sabal palmetto</i>	12	No	18	14	1	Good (61% to 80%)			
104	Cabbage Palm	<i>Sabal palmetto</i>	8	No	22	14	1	Fair (41% to 60%)	Bent Trunk		
105	Cabbage Palm	<i>Sabal palmetto</i>	8	No	22	14	1	Fair (41% to 60%)	Bent Trunk		
106	Cabbage Palm	<i>Sabal palmetto</i>	8	No	20	14	1	Fair (41% to 60%)	Bent Trunk		
107	Cabbage Palm	<i>Sabal palmetto</i>	8	No	20	14	1	Fair (41% to 60%)	Bent Trunk		
108	Jatropha	<i>Jatropha Spp.</i>	8	Yes	10	12	5	Poor (21% to 40%)	Co-Dominant Leaders	Limb Damage - Minor	Bent Leader
109	Jatropha	<i>Jatropha Spp.</i>	10	Yes	16	14	3	Poor (21% to 40%)	Co-Dominant Leaders	Limb Damage - Minor	Bent Leader
110	Cabbage Palm	<i>Sabal palmetto</i>	14	No	20	14	1	Fair (41% to 60%)	Leaning		
111	Cabbage Palm	<i>Sabal palmetto</i>	14	No	24	14	1	Fair (41% to 60%)	Leaning		
112	Cabbage Palm	<i>Sabal palmetto</i>	12	No	24	14	1	Fair (41% to 60%)	Leaning		
113	Cabbage Palm	<i>Sabal palmetto</i>	14	No	26	14	1	Good (61% to 80%)			
114	Cabbage Palm	<i>Sabal palmetto</i>	13	No	24	14	1	Good (61% to 80%)			
115	Cabbage Palm	<i>Sabal palmetto</i>	13	No	18	14	1	Good (61% to 80%)	Leaning		
116	Cabbage Palm	<i>Sabal palmetto</i>	8	No	18	14	1	Fair (41% to 60%)	Leaning		
117	Live Oak	<i>Quercus virginiana</i>	38	No	40	36	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	Sprouting
118	Live Oak	<i>Quercus virginiana</i>	18	No	40	38	1	Fair (41% to 60%)	Bent Leader	Limb Damage - Minor	Sprouting
119	Queen Palm	<i>Syagrus romanzoffiana</i>	10	No	24	16	1	Fair (41% to 60%)	Tapered Trunk		
120	Queen Palm	<i>Syagrus romanzoffiana</i>	10	No	22	16	1	Good (61% to 80%)			
121	Queen Palm	<i>Syagrus romanzoffiana</i>	12	No	22	16	1	Good (61% to 80%)			
122	Queen Palm	<i>Syagrus romanzoffiana</i>	10	No	24	16	1	Good (61% to 80%)			
123	Queen Palm	<i>Syagrus romanzoffiana</i>	10	No	20	16	1	Good (61% to 80%)			
124	Queen Palm	<i>Syagrus romanzoffiana</i>	10	No	24	16	1	Good (61% to 80%)			
125	Queen Palm	<i>Syagrus romanzoffiana</i>	8	No	24	16	1	Good (61% to 80%)			
126	Queen Palm	<i>Syagrus romanzoffiana</i>	8	No	18	16	1	Fair (41% to 60%)	Bent Trunk	Trunk Damage	
127	Queen Palm	<i>Syagrus romanzoffiana</i>	10	No	22	16	1	Fair (41% to 60%)	Tapered Trunk		
128	Queen Palm	<i>Syagrus romanzoffiana</i>	10	No	22	16	1	Fair (41% to 60%)	Leaning		
129	Queen Palm	<i>Syagrus romanzoffiana</i>	12	No	24	16	1	Fair (41% to 60%)	Some Fronds Missing		
130	Queen Palm	<i>Syagrus romanzoffiana</i>	12	No	20	16	1	Good (61% to 80%)			
131	Queen Palm	<i>Syagrus romanzoffiana</i>	8	No	20	16	1	Fair (41% to 60%)	Tapered Trunk		
132	Queen Palm	<i>Syagrus romanzoffiana</i>	8	No	22	16	1	Fair (41% to 60%)	Tapered Trunk		
133	Cabbage Palm	<i>Sabal palmetto</i>	10	No	20	14	1	Fair (41% to 60%)	Bent Trunk		
134	Cabbage Palm	<i>Sabal palmetto</i>	12	No	20	14	1	Fair (41% to 60%)	Bent Trunk		
135	Cabbage Palm	<i>Sabal palmetto</i>	13	No	18	14	1	Fair (41% to 60%)	Bent Trunk		
136	Cabbage Palm	<i>Sabal palmetto</i>	13	No	18	14	1	Fair (41% to 60%)	Bent Trunk		
137	Cabbage Palm	<i>Sabal palmetto</i>	12	No	18	14	1	Fair (41% to 60%)	Yellow Fronds	Tapered Trunk	
138	Cabbage Palm	<i>Sabal palmetto</i>	13	No	18	14	1	Fair (41% to 60%)	Leaning		
139	Cabbage Palm	<i>Sabal palmetto</i>	12	No	20	14	1	Fair (41% to 60%)	Yellow Fronds		
140	Live Oak	<i>Quercus virginiana</i>	25	No	40	36	1	Poor (21% to 40%)	Bent Leader	Adj Power Lines	Limb Damage - Minor
141	Live Oak	<i>Quercus virginiana</i>	24	No	40	34	1	Poor (21% to 40%)	Co-Dominant Leaders	Adj Power Lines	Limb Damage - Minor
142	Live Oak	<i>Quercus virginiana</i>	19	No	36	38	1	Fair (41% to 60%)	Co-Dominant Leaders	Lopsided	Limb Damage - Minor
143	Live Oak	<i>Quercus virginiana</i>	24	No	42	40	1	Fair (41% to 60%)	Co-Dominant Leaders	Limb Damage - Minor	
144	Jacaranda	<i>Jacaranda mimosifolia</i>	22	No	38	40	1	Fair (41% to 60%)	Limb Damage - Major	Sprouting	
145	Weeping Fig	<i>Ficus benjamina</i>	61	No	42	60	1	Fair (41% to 60%)	Limb Damage - Minor	Co-Dominant Leaders	
146	Weeping Fig	<i>Ficus benjamina</i>	74	No	46	64	1	Fair (41% to 60%)	Limb Damage - Minor	Co-Dominant Leaders	
147	Mahogany	<i>Swietenia mahagoni</i>	18	No	40	30	1	Fair (41% to 60%)	Co-Dominant Leaders		